



Turtle Beach Ear Force XO Four Audio Adapter Replacement

Replace audio adapter components on the Turtle Beach Ear Force XO Four headset.

Written By: Cody Barrett



INTRODUCTION

When the audio adapter is not properly adjusting the volume or mute function, there may be a problem with the components that can be replaced. This guide shows you how to get to these parts.

TOOLS:

- [T4 Torx Screwdriver](#) (1)
 - [T5 Torx Screwdriver](#) (1)
 - [Phillips #000 Screwdriver](#) (1)
-

Step 1 — Audio Adapter




- With your fingers, pry apart the back casing of the audio adapter.
- ⓘ A lot of force is required, so do not be afraid to pull hard.

Step 2





- Remove the three black T4 4.9mm screws from around the outside on the back of the audio adapter.
- Loosen the two silver T5 screws as much as possible.
- ⓘ These two silver screws do not detach from the audio adapter.

Step 3

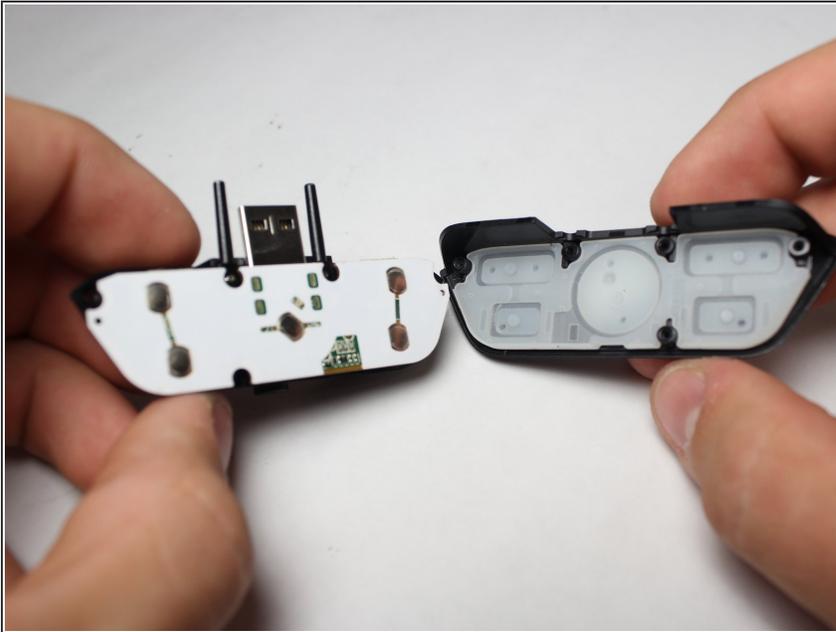



- Separate the two pieces to reveal the rubber casing behind the buttons.

Step 4

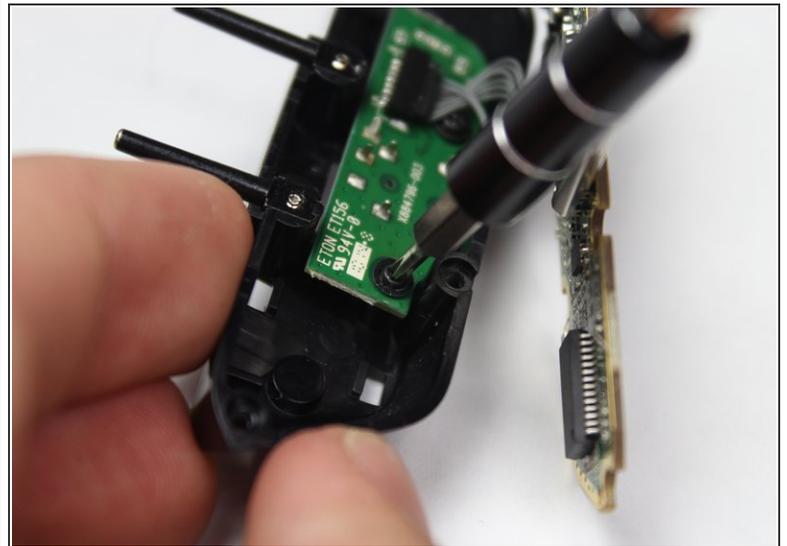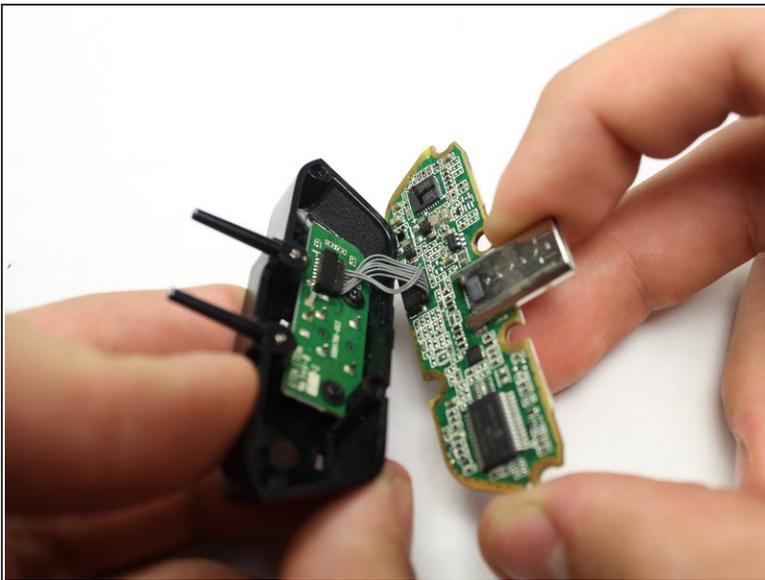

- Remove the two PH000 5.5mm screws from the smaller circuit board.
- Remove the board.

Step 5

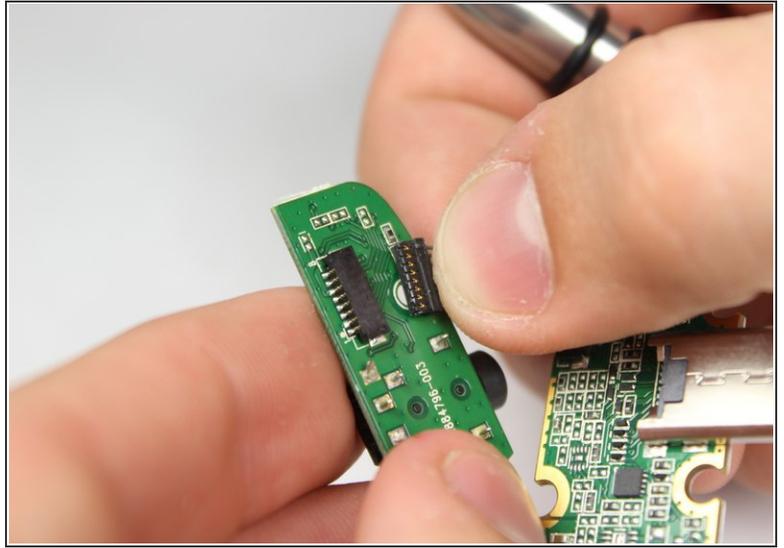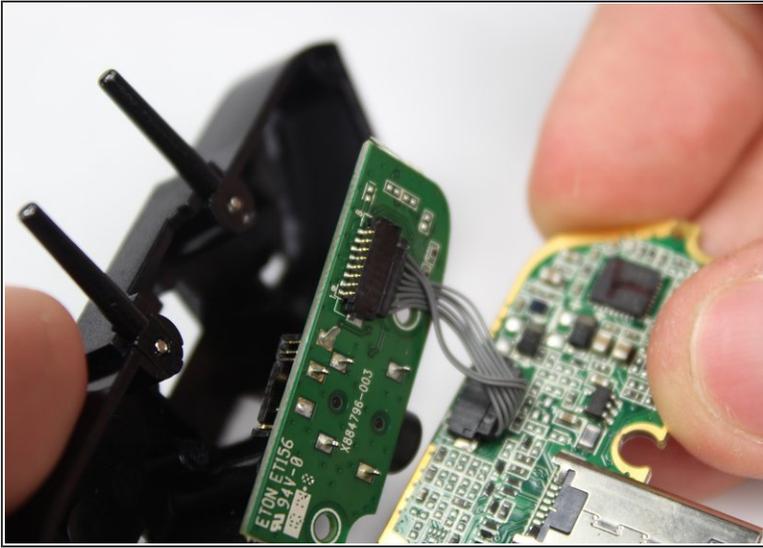

- Detach the wires from the smaller circuit board.

To reassemble your device, follow these instructions in reverse order.